

**Simpson 260® Series 9S & 9SP  
Volt-Ohm-Milliammeter  
INSTRUCTION MANUAL**



SIMPSON ELECTRIC COMPANY 520 Simpson Avenue  
Lac du Flambeau, WI 54538-0099 (715) 588-3311 FAX (715) 588-3326  
Printed in U.S.A. Part No. 06-117867 Edition 2, 05/07  
Visit us on the web at: [www.simpsonelectric.com](http://www.simpsonelectric.com)

### About this Manual

To the best of our knowledge and at the time written, the information contained in this document is technically correct and the procedures accurate and adequate to operate this instrument in compliance with its original advertised specifications.

### Notes and Safety Information

This Operator's Manual contains warning headings which alert the user to check for hazardous conditions. These appear throughout this manual where applicable, and are defined below. To ensure the safety of operating performance of this instrument, these instructions must be adhered to. This product has been designed to meet UL 61010-1 requirements at 600V, Category III.



Warning, refer to accompanying documents.



Caution, risk of electric shock.

This instrument is designed to prevent accidental shock to the operator when properly used. However, no engineering design can render safe an instrument which is used carelessly. Therefore, this manual must be read carefully and completely before making any measurements. Failure to follow directions can result in serious or fatal accident.

**Shock Hazard:** As defined in American National Standard, C39.5, Safety Requirements for Electrical and Electronic Measuring and Controlling Instrumentation, a shock hazard shall be considered to exist at any part involving a potential in excess of 30 volts RMS (sine wave) or 42.4 volts DC or peak and where a leakage current from that part to ground exceeds 0.5 milliampere, when measured with an appropriate measuring instrument defined in Section 11.6.1 of ANSI C 39.5.

### Technical Assistance

SIMPSON ELECTRIC COMPANY offers assistance Monday through Friday  
8:00 am to 4:30 pm Central Time by contacting Technical Support or  
Customer Service at (847) 697-2260.  
Internet: <http://www.simpsonelectric.com>

### Warranty and Returns

SIMPSON ELECTRIC COMPANY warrants each instrument and other articles manufactured by it to be free from defects in material and workmanship under normal use and service, its obligation under this warranty being limited to making good at its factory or other article of equipment which shall within one (1) year after delivery of such instrument or other article of equipment to the original purchaser be returned intact to it, or to one of its authorized service centers, with transportation charges prepaid, and which its examination shall disclose to its satisfaction to have been thus defective; this warranty being expressly in lieu of all other warranties expressed or implied and of all other obligations or liabilities on its part, and SIMPSON ELECTRIC COMPANY neither assumes nor authorizes any other persons to assume for it any other liability in connection with the sales of its products.

This warranty shall not apply to any instrument or other article of equipment which shall have been repaired or altered outside the SIMPSON ELECTRIC COMPANY factory or authorized service centers, nor which has been subject to misuse, negligence or accident, incorrect wiring by others, or installation or use not in accord with instructions furnished by the manufacturer.

**260® is a Registered Trademark of the Simpson Electric Company.**

### Notes

## 4.5 Care

- a. Do not attempt to clean this Instrument with the test leads connected to a power source.
- b. Immediately clean all spilled materials from the Instrument and wipe dry. If the spillage is corrosive, use a suitable cleaner to neutralize the corrosive action.
- c. Do not allow the battery to fully discharge. When the batteries reach the end of their useful life, they should be promptly replaced. Failure to do so may result in corrosion at the battery contacts due to battery leakage.
- d. Avoid prolonged exposure or usage in areas which are subject to temperature and humidity extremes, vibration or mechanical shock, dust or corrosive fumes, or strong electrical or electromagnetic interferences.
- e. Verify Instrument accuracy by performing operational checks using known, accurate, stable sources. If proper calibration equipment is not available, contact the nearest Authorized Service Center.
- f. It is recommended that the Instrument be returned annually to the nearest Authorized Service Center, or to the factory, for an overall check, adjustment, and calibration.
- g. When not in use, store Instrument in a room free from temperature extremes, dust, corrosive fumes, and mechanical vibration or shock.  
If Instrument is stored more than thirty days, remove batteries.

## Contents

1. Introduction. . . . .	4
1.1 General Description. . . . .	4
1.2 Overload Protection. . . . .	4
1.2.1 Fuses. . . . .	5
1.3 Internal Batteries. . . . .	5
1.4 Overload Circuit Test. . . . .	5
1.5 Printed Circuit. . . . .	5
1.6 Adjust-A-View Handle. . . . .	5
1.7 Test Leads. . . . .	6
1.8 Technical Data. . . . .	6
1.9 Definition Of Accuracy. . . . .	7
1.10 Safety Considerations. . . . .	7
1.11 Audio Alarm. . . . .	7
1.12 Accessories. . . . .	8
1.13 Additional Accessories. . . . .	8
1.13.1 Amp-Clamp Model 150-2. . . . .	8
2. INSTALLATION. . . . .	8
2.1 Unpacking and Inspection. . . . .	9
2.2 Warranty. . . . .	9
2.3 Shipping. . . . .	9
2.4 Power Source Requirements. . . . .	9
2.5 Operating Position. . . . .	9
3. OPERATION. . . . .	9
3.1 Safety Precautions. . . . .	10
3.2 Operational Items and Features. . . . .	11
3.3 Polarity Reversing. . . . .	11
3.4 Measurement of Unknown Voltage or Current. . . . .	12
3.5 Test Leads. . . . .	12
3.6 DC Voltage Measurement. . . . .	12
3.6.1 DC Voltage Measurement 0-250 mV Range. . . . .	12
3.6.2 DC Voltage Measurement 0-2.5 Through 0-100V Range. . . . .	13
3.6.3 DC Voltage Measurement 0-250V Range. . . . .	13
3.6.4 DC Voltage Measurement 0-600V Range. . . . .	14
3.7 AC Voltage Measurement. . . . .	15
3.7.1 AC Voltage Measurement 0-2.5 Thru 0-100V Range. . . . .	15
3.7.2 AC Voltage Measurement 0-250V Range. . . . .	16
3.7.3 AC Voltage Measurement 0-600V Range. . . . .	17
3.8 Decibel Measurement (-20 to +50 dB). . . . .	18
3.9 Direct Current Measurement. . . . .	18
3.9.1 Direct Current Measurement 0-1mA through 600mA Range. . . . .	19
3.9.2 Direct Current Measurement 0-10A Range. . . . .	19
3.9.3 Alternating Current Measurement 0-10A Range. . . . .	20
3.10 Zero Ohms Adjustmens. . . . .	21
3.11 Measuring Resistance. . . . .	21
3.12 Resistance Measurement of Semiconductors. . . . .	22
3.13 Continuity Tests. . . . .	23
4. OPERATING SERVICING. . . . .	23
4.1 Removing the Instrument Case. . . . .	23

## Contents Continued

4.2	Battery and Fuse Replacement. . . . .	23
4.3	Fuse Protection. . . . .	24
4.5	Care. . . . .	25

If the pointer cannot be adjusted to zero ohms or the R X 1 or R X 100 range, replace the 1.5 V battery. If the pointer cannot be adjusted to zero on the R X 10,000 range replace the 9 V battery.

a. To replace the “D” size battery:

1. Remove the old 1.5 V battery.
2. Insert the (-) end of battery first, pushing against the (-) terminal spring clip, then gently push the (+) side of the battery into place.

b. To replace the 9 V battery:

1. Remove the battery with the mating connector from the compartment.
2. Take the connector off the old battery and connect it to the new battery.
3. Insert new battery into the compartment.
4. Place the connector leads so they rest between the cavity walls and clear the fuse terminals. The extended leads are placed between the battery holder and the top wall of the case.

**NOTE:** 1 Amp and/ or 2 Amp fuse replacement is necessary when there is no meter deflection on any of the DC, AC Volts or Ohms ranges but the DC Amps range operates properly.

c. To replace the 1 Amp fuse:

1. Pull defective fuse from its retaining spring clips.
2. Snap-in the replacement fuse and replace the cover.

**NOTE:** A spare fuse is located in a cavity next to the fuse clip.

### 4.3 Fuse Protection

A 1 Amp 250V quick-acting fuse and a 2A high voltage, high interruption capacity fuse are connected in a series with the input circuit as additional protection to the VOM against excessive energy fault current, such as a power line overload.

It is important to replace the 1 Amp fuse with a Littlefuse Type 312001 only to prevent the 2 Amp high interruption capacity fuse from opening on nominally high overload.

If the Instrument fails to indicate, the 1 Amp or the 2 Amp fuses may be burned out. (Refer to paragraph 4.2 for fuse replacement.) A 1 Amp spare fuse is furnished with each Instrument. (Both 1 Amp fuses are located in the battery and fuse compartment.) The 2 Amp fuse is located on the Instrument panel under the printed circuit board.

### 3.13 Continuity Tests

Turn off all power to the circuit being tested before proceeding any further.

- a. Set the FUNCTION switch to the F| (note) And the RANGE t o any ohms . Insert the black test lead into the COMMON (-) and the red test lead into the (+) jack.
- b. Touch the test lead probe tips together. An audio sound should be heard.
- c. To test for continuity, probe the circuit or component in question. An audible sound indicates continuity.

The higher the circuit's resistance, the lower the sound level. The lower the circuit's resistance, the higher the sound level.

## 4. OPERATING SERVICING

This Instrument has been carefully designed and constructed with high-quality components. By providing reasonable care and following the instructions in this manual, the user can expect a long service life from these instruments.

Before opening the battery compartment cover, disconnect the test leads from live circuits.

### 4.1 Removing the Instrument Case

To gain access to the inside of the Instrument panel, disconnect the test leads and remove the cover from the battery compartment. Next, remove the four case-fastening screws and lift the case from the panel.

When replacing the case, make certain that the wires leading to the battery compartment are seated in their respective slots within the compartment wall. This will prevent damage to the wire insulation.

### 4.2 Battery and Fuse Replacement

The batteries and 1 Amp fuse are located inside an isolated compartment at the top-rear of the Instrument case. To open the battery and fuse compartment:

- a. Place the Instrument face down on a soft padded surface.
- b. Unscrew the single screw on the cover.
- c. Remove the cover from the case and set aside. Batteries and fuse may now be replaced.

**NOTE:** If replacement of the 2 Amp high current interrupting fuse is necessary, the Instrument case must be removed.

Typically if the high energy fuse is blown, there will be other internal damage. It is recommended that this type of repair be performed by a qualified repair center only.

## 1. INTRODUCTION

### 1.1 General Description

The Simpson Volt-Ohm-Milliammeter 260 Series 9, (hereafter referred to as the 260 or the Instrument) is a rugged, accurate, compact, easy-to-use instrument equipped with mirrored dial to eliminate parallax. The Instrument can be used to make accurate measurements of AC and DC voltage, direct current, resistance, and decibels. New Features in the 260-9 are:

- 10 Amp AC measurement
- DC blocked AC input
- Meets UL Specification 601010
- High Impact Case (Black)

### 1.2 Overload Protection (9S Version)

All the ranges, with exception of 10 Amp and 600 volt are protected by an electronic overload protection system. The protection is from the usual overloads that would damage the VOM. A transistorized circuit senses the voltage drop across the indicating instrument and actuates a relay when the voltage reaches approximately 3 to 4 times rated full scale voltage. Sensing of the voltage drop is by means of a bridge network so that overload protection is provided regardless of polarity. The relay operates at a uniform percent of overload since the indicating instrument circuit is common to all ranges. When actuated by an overload, the relay contacts, which are in the -COMMON CIRCUIT, latch open until the reset button on the front panel is depressed.

Due to its sensitivity to overloads, the electronic overload protection relay incorporated in the 260 is susceptible to electrostatic fields from high potentials or transients either in the circuit being measured or in nearby circuitry.

Do not assume the relay to be faulty if it trips out without apparent cause. It may be indicating a dangerous condition such as excessive circuit-to-ground (floating) voltage being applied to the Instrument.

Avoid loading the Instrument or its test leads until certain that excessive circuit-to-ground voltage does not exist.

- a. The safety circuit is designed to limit battery drain . When the overload protection is tripped, the relay opens the battery circuit. When the reset button has been pressed so that the VOM is operational; the protection circuit draws less than the shelf life drain of the battery.
- b. Since the 9 V battery is used for both the R X 10,000 range and the protection circuit, the VOM is designed to allow the protection circuit to function normally as long as the R X 10,000 range can be set to zero and an Alkaline battery is used.
- c. The 1 and 2 Amp fuses in the input circuit offer additional protection to the meter. Some overload conditions may cause the fuses to burn out as well as open the overload protection relay .
- d. When an overload of sufficient magnitude is applied to the VOM, the reset button will "pop up" approximately 3/16 inch above the surface of the panel. To reset the VOM for normal operation, first remove the overload and depress the button. If the overload remains connected to the Instrument, resetting the overload protection reset button will not connect the VOM input circuit.

### 1.2.1 Fuses (Both 9S & 9SP)

Basic overload protection is provided by a small inexpensive and easily obtainable 3 AG type, 1 Amp, quick-blow fuse. This fuse is rated to interrupt circuit voltages up to 250V. A supplemental high energy fuse is provided for additional protection from severe overloads. This fuse is the Bussman Type BBS 2A 600V with an interrupt capacity of 10,000 Amps AC. The Littlefuse Type BLS 2A 600V may also be used.

**NOTE:** If the 260 fails to indicate a reading, the 1 or 2 Amp fuse may be burned out. (Refer to paragraph 4.2 for fuse replacement.) Use only the specified fuse type. The 0-10 A range is not fused. The shunt connects directly to the -10 A and +10 A jacks.

The relay, fuse and diodes will prevent serious damage to the Instrument in most cases of accidental overload. However, no overload protection system is completely foolproof and misapplication on high voltage circuits can damage the Instrument. Exercise care and caution to protect both the user and the Instrument.

### 1.3 Internal Batteries

Two batteries are in the ohmmeter circuits, a NEDA 13F “D” cell that furnishes 1.5 V for the R X 1 and R X 100 ranges and a NEDA 1604A Alkaline battery that furnishes 9 V for the R X 10,000 range. The 1.5 V “D” cell is held in place with two spring clips which also serve as battery contacts. The polarity symbols for the “D” cell are marked near the battery contacts. The 9 V battery is held in place with a spring clip, but contact is made with a separate connector that is polarized. Always observe correct polarity when replacing the 1.5 V “D” cell.

The 9 V battery must be installed and tested before the Instrument is ready for use. The 9XP relies on the 9 V battery for proper operation. Perform the overload test described in Paragraph 1.4 to ensure proper overload circuit operation prior to using the Instrument.

### 1.4 Overload Circuit Test

- a. Set the range switch to R X 10,000 position and the function switch to the -DC position.
- b. Plug the black test lead into the -COMMON jack terminal and touch the other end of the test lead to the +10 A input terminal. (The relay reset button should pop up, indicating that the overload circuit is in working condition.)
- c. Reset the overload relay button.

**NOTE:** No damage will occur to the Instrument as a result of this test.

### 1.5 Printed Circuit

Most of the component parts are mounted on a printed circuit board which simplifies assembly and maintenance, thus extending the useful life of the Instrument.

### 1.6 Adjust-A-View Handle

A carrying handle is attached to the Instrument case. The handle may be used to support the Instrument in a convenient sloping position for easy viewing. The case can also be placed in either a vertical or horizontal position. The horizontal position is preferable for greater accuracy since the Instrument is calibrated in this position.

- c. Set the function switch at either -DC or +DC position. The results are the same in either position unless there are semiconductors in the circuit ((see paragraph 3.14). Adjust ZERO OHMS control for each resistance range.

- d. Observe the reading on the OHMS scale at the top of the dial.

**NOTE:** The OHMS scale reads from right to left for increasing values of resistance.

- e. To determine the resistance value, multiply the reading by the factor at the switch position. (The ‘K’ on the OHMS scale equals one thousand.)

### 3.12 Resistance Measurement of Semiconductors

Make sure that the OHMS range being used will not damage any of the semiconductors (refer to Table 1-1, item 8, Section I).

If there is a “forward” and “backward” resistance such as in diodes, the resistance should be relatively low in one direction (for forward polarity) and higher in the opposite direction.

Rotate the function switch between the two DC positions to reverse polarity. This will determine if there is a difference between the resistance in the two directions. To check a semiconductor in or out of a circuit (forward and reverse bias resistance measurements) consider the following before making the measurement:

- a. The polarity of the battery voltage will be as marked at the jacks when the switch is in the +DC position and reversed in the -DC position.
- b. Ensure that the range selected will not damage the semiconductor. (Refer to Table 1-1, item 8 and review the specification limits of the semiconductor according to the manufacturer’s ratings.)
- c. If the semiconductor is a silicon diode or conventional silicon transistor, no precautions are normally required.
- d. If the semiconductor material is germanium, check the ratings of the device and refer to Table 1-1, item 8, Section 1.

**NOTE:** The resistance of diodes will measure differently from one resistance range to another on the VOM with the function switch in a given position. For example, a diode which measures 80 ohms on the R X 1 range may measure 300 ohms on the R X 100 range. The difference in values is a result of the diode characteristics and is not indicative of any fault in the VOM.

3.10 Zero Ohms Adjustment

When resistance is measured, the INTERNAL batteries B1 and B2 furnish power for the circuit. Since batteries are subject to variation in voltage and internal resistance, the Instrument must be adjusted to zero before measuring a resistance, as follows:

- a. Turn range switch to desired ohms range.
- b. Plug the black test lead into the -COMMON jack and the red test lead into the +jack.
- c. Connect the ends of test leads together to short the VOM resistance circuit.
- d. Rotate the ZERO OHMS control until pointer indicates zero ohms. If pointer cannot be adjusted to zero, one or both of the batteries must be replaced. (For battery replacement, refer to Section 4.)
- e. Disconnect shorted test leads.



Figure 3.9

3.11 Measuring Resistance

Voltage applied to a resistance range will cause reading errors if low and damage the Instrument if high. When making in-circuit measurements, make certain that the circuit is completely de-energized before making connections to it.

When making in-circuit measurements, circuit paths in parallel with the resistance being measured may cause reading errors. Check circuit diagrams for the presence of such components before assuming that the reading obtained is correct.

- a. Before measuring resistance in a circuit, make sure the power is off to the circuit being tested and all capacitors are discharged. Disconnect shunting components from the circuit before measuring its resistance.
- b. Set the range switch to one of the resistance range positions as follows:
  - 1. Use R X 1 for resistance readings from 0 to 200 ohm.
  - 2. Use R X 100 for resistance readings from 200 to 20,000 ohm.
  - 3. Use R X 10,000 for resistance readings above 20,000 ohm.

1.7 Test Leads

Each Instrument is furnished with one pair (Catalog Number 07546) of probe type test leads (one red and one black, each 48 inches long) for all applications of the Instrument. These test leads have retractable bananas on one end to connect the leads to the recessed jacks on the Instrument front panel. The probe tips at the opposite end have threaded shoulders to accept the screw-on insulated alligator clips (furnished with the test leads) Maximum ratings are 600V AC or DC or 10 Amps AC or DC. These ratings for the test leads must not be exceeded in any application.

1.8 Technical Data

Table 1-1. Technical Data

1.	DC VOLTS:	
	Ranges:	0-2.5-10-25-60-100-250-600V
	Sensitivity:	20,000 ohms per volt
2.	DC MILLIVOLTS:	
	Range:	0-250mV
	Sensitivity:	20,000 ohms per volt
3.	AC VOLTS:	
	Ranges:	0-2.5-10-25-60-100-250-600V
	Sensitivity:	5,000 ohms per volt
4.	DC MILLIAMPERES:	
	Ranges:	0-1-10-100-600 mA
	Voltage Drop (Approx.):	250 mV

NOTE: The 10A range is not internally fused.

5.	DC AMPERES:	
	Range:	0-10A
	Voltage Drop (Approx.):	250 mV
6.	AC AMPERES:	
	Range:	0-10A
	Voltage Drop (Approx.):	250 mV
7.	RESISTANCE:	
	Range:	RX1 ( 1ohm major steps), RX100 (100 ohm major steps), RX10,000 (10,000 ohm major steps)
8.	*ACCURACY:	
	DC Voltage Ranges:	2% of Full Scale
	DC Current:	2% of Full Scale
	**AC Voltage Ranges:	3% of Full Scale
	AC Current:	3% of Full Scale
	Frequency Response:	Referenced to 100 Hz (Figures 3-2 and 3-3)
	Resistance Ranges:	
	R X 1:	2.5° of Arc
	R X 100:	2° of Arc
	R X 10,000:	2° of Arc



9. DECIBELS:  
Range: -20 to +10 dB, -8 to +22 dB, 0 to 30 dB  
13 to 43 dB  
Reference Level: With zero dB power level equal to 1 mW across a 600 Ohm line.
10. BATTERIES:  
Voltage: 1.5V, 9V  
NEDA No.: 13F, 1604A
11. FUSE:  
F1 1A, 250V, type 3AG, quick-acting Littlefuse Type 312001, F2 2A, 600V Littlefuse Type BLS or 2A 600V, Bussman Type BBS.
12. TEST LEADS: 1 red, 1 black, 48" long.
13. SIZE: 5 1/4" x 7" x 3 1/8" (13.34 x 17.78 x 7.94 cm)
14. WEIGHT: 2 1/4 lbs (1.02 Kg)
15. \*\*\*RATED CIRCUIT-TO  
-GROUND VOLTAGE: 600V AC/DC Max.

- \* Accuracies specified are for the 260 in a horizontal position.
- \*\* Responds to the average value of an AC current, and is calibrated to indicate the RMS value of a pure sine wave.
- \*\*\* Per ANSI C39.5 April 1974: "The specified voltage with respect to ground, which may be safely and continuously applied to the circuit of an Instrument."
- \*\*\*\* **Operating Temperature:** 0°C to +50°C  
**Storage Temperature:** -10°C to +60°C  
**Relative Humidity:** Maximum relative humidity 80% for temperature up to 31°C and decreasing linearly to 50% relative humidity at 50°C.  
**Ambient Temperature:** 25°C

## 1.9 Definition Of Accuracy

The voltage and current accuracy of this Instrument is commonly expressed as a percent of full scale. This should not be confused with accuracy of reading (indication). For example, +/-2% of full scale on the 10 volt range allows an error of +/-200mV at any point on the dial. This means that at full scale, the accuracy reading would be +/-2%, but at half scale it would be +/-4%. Therefore, it is advantageous to select a range which gives an indication as near as possible to full scale.

## 1.10 Safety Considerations

This Operator's Manual contains cautions and warnings alerting the user to hazardous operating and service conditions. This information is flagged by CAUTION or WARNING symbols throughout the publication, where applicable, and is defined on the inside front cover under "Notes and Safety Information." Adhere to these instructions in order to ensure the safety of operating and servicing personnel and to retain the operating conditions of the Instrument.

**NOTE:** The function switch has no effect on polarity for the 10 AMPS DC range.

- e. Turn the power on. Read the current directly on the black DC scale. Use the 0-10 figures to read directly in amperes.
- f. Turn the power off and disconnect the test leads.

### 3.9.3 Alternating Current Measurement 0-10A Range



**Figure 3.8**

- a. Plug the black test lead into the -10A jack and the red test lead into the +10A jack.
- b. Set the function switch at AC
- c. Set the range switch at 10 AMPS AC (dual position with 10Volt).
- d. Open the ground side of the circuit in which the current is being measured. Connect the VOM in series with the circuit, connecting the red test lead to the positive side and the black test lead to the negative side.
- e. Turn the power on. Read the red scale marked AC and use the black figure immediately above the scale. Use the 0-10 figures to read directly in amperes.
- f. Turn the power off and disconnect the test leads.



The 10A range is not internally fused in the 260. When using the 10A range, never disconnect a test lead from a jack or from the circuit while the circuit is energized. Doing so may damage the test jacks or leads and the arcing may be hazardous to the operator. Turn off circuit power and wait for the meter reading to drop to zero.

The polarity reversing feature of the function switch does not operate on the 0-10A range. If polarity is found to be incorrect, turn off circuit power, wait for the meter indication to read zero and then interchange test lead connections to the circuit.



3.9.1 Direct Current Measurement 0-1mA Through 0-600mA Range

- a. Set the function switch at +DC.
- b. Plug the black test lead into the -COMMON jack and the red test lead into the +jack.
- c. Set the range switch at one of the four range positions marked 1 mA, 10 mA, 100 mA or 600 mA.
- d. Open the grounded side of the circuit in which the current is being measured. Connect the VOM in series with the circuit. Connect the red test lead to the positive side and the black test lead to the negative side.
- e. Turn the power on. Read the current in milliamperes on the black DC scale. For the 1 mA range, use the 0-10 figures and divide by 10. For the 10 mA range, use the 0-10 figures directly. For the 100 mA range, use the 0-10 figures and multiply by 10. For the 500 mA range, use the 0-60 figures and multiply by 10.
- f. Turn the power off and disconnect the test leads.

This range is only intended for measurements in low voltage circuits (under 25 V DC) such as the primary power in vehicles or their accessories.

3.9.2 Direct Current Measurement 0-10A Range

- a. Plug the black test lead into the -10A jack and the red test lead into the +10A jack.



Figure 3.7

- b. Set the function switch at +DC
- c. Set the range switch at 10 AMPS (dual position with 10mA).
- d. Open the ground side of the circuit in which the current is being measured. Connect the VOM in series with the circuit, connecting the red test lead to the positive side and the black test lead to the negative side.

1.11 Audio Alarm

The 260 Audio Alarm transducer will emit an audio sound when the continuity (ohms range) of a circuit being tested is completed.

No Circuit Continuity Tests are to be made with electrical power “ON.” Turn “OFF” all electrical power.

1.12 Accessories

Table 1-2. Items and Accessories Furnished with this Instrument.

Quantity	Description	Number
1	Test Lead Set - one red and one black (48” long) each with combination probe tip and removable rubber-sleeved alligator clip.	07546
*1	1.5 Volt, D Cell, NEDA 13F	
*1	9.0 Volt Cell, NEDA 1604A (Alkaline)	
2	1 Amp, 250V Fuse, Littlefuse Type #312001	
1	2A, 600V Fuse, Littlefuse Type BLS (or Bussman Type BBS)	
1	Padded polyester case (Safety Orange)	00838
1	Operator’s Manual	6-117867

\*Batteries are standard items replaceable at local retail stores.

1.13 Additional Accessories

Table 1-3. Additional Accessories

Description	Catalog Number
Case, Black padded polyester	00834
Model 150-2 Amp-Clamp	00541

1.13.1 Amp-Clamp Model 150-2

The Simpson Amp-Clamp Model 150-2 allows AC current measurements without breaking the circuit under test. The Amp-Clamp works in effect as a transformer containing a split core for accommodating the conductor which carries the current being measured. The current-carrying conductor becomes the transformer primary and a coil in the Amp-Clamp serves as the secondary winding. The Amp-Clamp output voltage is proportional to the current measured and can be applied to the 260-9 as an AC voltage.

The Amp-Clamp has a range selector with six positions. Any of the following current ranges can be used with the 260-9: 5A AC, 10A AC, 25A AC, 50A AC, 100A AC or 250 A AC.

**NOTE:** Instructions are furnished with each Amp-Clamp.

## 2. INSTALLATION

This section contains information and instructions for the installation and shipping of the Simpson 260-9X. Included are unpacking and inspection procedures, warranty, shipping, power source requirements and operating position.

### 2.1 Unpacking and Inspection

Examine the shipping carton for obvious signs of damage. If damage is noted, notify the carrier and supplier and do not attempt to use the Instrument. If Instrument appears to be in good condition, read Operator's Manual in its entirety. Become familiar with the Instrument as instructed in the manual, then check the electrical performance as soon as possible. Make sure that all items are included with the Instrument (Table 1-2). After unpacking the Instrument, a 1.5V battery and a 9V battery may be found in separate envelopes in the box with the Instrument and the test leads. Two alligator clips for the test leads are in a polyethylene bag. See Section 4, for instructions on how to open the battery compartment and install the batteries.

### 2.2 Warranty

The Simpson Electric Company warranty policy is printed on the inside front cover of this manual. Read it carefully before requesting any warranty repairs. For LL assistance, contact the nearest Authorized Service Center or the factory directly. Give full details of any installation difficulties and include the Instrument model number, series number, and date of purchase. Service data or shipping instructions will be mailed promptly. If an estimate of charges for non-warranty or other service work is required, a maximum charge estimate will be quoted. This charge will not be exceeded without prior approval.

### 2.3 Shipping

Pack the Instrument carefully and ship it, prepaid and insured, to the proper destination.

### 2.4 Power Source Requirements

There are two batteries in the ohmmeter circuits: One is a NEDA 13F D size cell that furnishes 1.5 volts for the R X 1 and R X 100 ranges. A NEDA 1604A battery furnishes 9 volts for the R X 10,000 range. The 1.5 volt D cell is held in place with two spring clips which also serve as battery contacts. The 9-volt battery is held in place with a spring clip but contact is made with a separate connector that is polarized. (Always observe correct polarity when replacing the 1.5-volt D cell.)

### 2.5 Operating Position

A handle is attached to the side of the Instrument case. The handle may be used to support the Instrument in a convenient, sloping position for easy viewing. The VOM case can also be placed either in a vertical or horizontal position. The horizontal position is preferable for greater accuracy since the Instrument is calibrated in this position.

## 3. OPERATION

This section of the manual contains information required to use and operate the 260-9 in a safe and proper manner. Multifunction instruments (VOM's) such as the 260-9 are intended as general purpose measuring Instruments for use in low power circuitry such as found in consumer appliances, TV and radio receivers, and in general laboratory applications. Their use is not recommended in high voltage, high power circuitry where operator errors and inadequate personal protective measures could result in serious injury from arcing or explosion. Such circuitry is found in industrial or commercial applications such as induction (r-f) heaters and broadcast transmitters, power substations and distribution centers, x-ray equipment, large motor controls, etc. Working in the high voltage section of such equipment requires single-function, often specially designed instruments operated by specially trained personnel who use appropriate protective equipment and procedures.

- a. Set the function switch at AC.

**NOTE:** The meter will not indicate if the switch is incorrectly set to a DC position.

- b. Set the range switch at 100V/250V/600V position.
- c. Plug the black test lead into the -COMMON jack and the red test lead in the 600V jack.
- d. Make sure the power is off in the circuit being measured and that all its capacitors have been discharged.
- e. Connect the test leads across the circuit voltage to be measured with the black lead to the grounded side.
- f. Turn on the power in the circuit being measured.
- g. Read the voltage on the red scale marked AC. Use the 0-600 figures.

### 3. Decibel Measurement (-20 to +50 dB)

Certain industries measure in terms of voltage or current ratios (decibels) based on a specific reference level. The dB scale on the 260-9 serves this purpose and is calibrated to a reference level (zero dB) of 0.001 watt into 600 ohms. The scale calibration of -20 to +10 dB is for the 0-2.5V range (zero dB = 0.775V). Higher ranges may be used by adding an appropriate dB value to the reading in accordance with the chart below.

- a. Review the safety precautions in paragraph 3.1.
- b. Use operating instructions for AC VOLTAGE MEASUREMENT, 0-2.5/10/25/60/100V RANGES (paragraph 3.8).
- c. Read decibels on the bottom scale marked dB. For the 10/25/60/100V ranges, add the appropriate factor from the following chart.

**NOTE:** The maximum voltage ratio that can be measured is +50 dB on the 0-250V range.

- d. If dB measurements are being made to a 0.006 watt into 250V reference level, subtract +7 dB from the reading obtained on the 260.

### 3.9 Direct Current Measurement

Do not change the range setting of the range or function switches while the circuit is energized.

Never disconnect test leads from the circuit under measurement while it is energized.

Always turn the power off and discharge all the capacitors before changing switch settings or disconnecting leads.

Never exceed the circuit-to-ground voltage of the instrument (600 V max., Table 1-1, item 16).

Always connect the instrument in series with the ground side of the circuit.

In all direct current measurements, make certain that the power to the circuit being tested has been turned off before connecting and disconnecting test leads or restoring circuit continuity.

- a. Set the function switch to AC volts only position.

**NOTE:** The meter will not indicate if the switch is incorrectly set to a DC position.

- b. Set the range switch at 100V/250V/600V position.
- c. Plug the black test lead into the -COMMON jack and the red test lead in the 250V jack.
- d. Be sure the power is off in the circuit being measured and that all its capacitors have been discharged.
- e. Connect the test leads across the circuit voltage to be measured with the black lead to the grounded side.
- f. Turn on the power in the circuit being measured.
- g. For the 250V range, read the red scale and use the black figure immediately above the scale. Multiply reading by 10.

### 3.7.3 AC Voltage Measurement 0-600V Range

Use extreme care when working in high voltage circuits. Do not handle the Instrument or test leads while the circuit being measured is energized. OBSERVE ALL SAFETY PRECAUTIONS in paragraph 3.1 and in the instruction manual for the equipment being tested. Do not attempt any voltage measurement which may exceed 600V or the circuit-to-ground voltage of the instrument, 600V maximum.

Do not attempt any voltage measurement which may exceed 600V or the circuit-to-ground voltage of the Instrument, 600V maximum.

Make certain that the range switch is set to the 100V/250V/600V range, function switch to AC volts only position, and test leads connected to COMMON and 600V jack.

Do not touch the Instrument or test leads while the power is on in the circuit being measured.



Figure 3.6

### 3.1 Safety Precautions

The following precautions are suggestions and reminders of commonly recognized safe practices as well as specific hazards to be avoided, and are not implied to be sufficient to ensure the safety of untrained personnel in all circumstances. Neither is this manual a substitute for technical manuals covering the equipment being measured. Always refer to the equipment manual and its specific warnings and instructions and observe them as well as those contained herein.

- a. The 260-9 should only be used by personnel qualified to recognize shock hazards and trained in the safety precautions required to avoid possible injury.
- b. Do not connect any terminal of this Instrument to a circuit point at which a voltage exceeding 600 volts AC or DC may exist with respect to earth ground. (Refer to Table 1-1, item 16.)
- c. Turn off power and discharge any capacitors in the circuit to be measured before connecting to or disconnecting from it.
- d. Before using this Instrument, check accessories, if any, and test leads for missing, damaged, deteriorated or otherwise faulty insulating parts. Do not use, or permit the use of, equipment with faulty insulation until it has been properly repaired.
- e. Always wear safety glasses when working in electrical circuitry.
- f. Do not work alone on high voltage circuits. Make certain that someone capable of giving aid is watching nearby.
- g. Do not handle the Instrument, its test leads, or the circuitry while high voltage is being applied.
- h. Hands, shoes, floor, and workbench must be dry. Avoid making measurements under humid, damp, or other environmental conditions that could effect the dielectric withstanding voltage of the test leads or Instrument.
- i. Do not change switch settings or test lead connections while the circuit is energized. A mistake could damage the instrument and cause personal injury.
- j. Locate all voltage sources and accessible current paths before making connections to circuitry.
- k. Make certain that the equipment being worked upon is properly grounded and fuses are of the proper type and rating.
- l. Double check switch positions and jack connections before applying power to the Instrument.
- m. Remain alert for low voltage circuits which may be floating at high voltage with respect to earth ground and for composite voltages (AC + DC) such as are found in r-f amplifiers. The floating voltage or composite voltage must not exceed the Instrument's rated maximum circuit-to-ground voltage.
- n. Do not make electrical measurements where the air may contain explosive concentrations of gas or dust such as in mines, grain elevators, gasoline stations or in the presence of charging batteries until determined to be safe by qualified personnel. Note that even metallic dusts can be explosive.

- o. No General Purpose VOM is to be used to make electrical measurements on blasting circuits or blasting caps.

3.2 Operational Items and Features

Table 3-1 describes the function of all the items used to operate the Instrument. These items are illustrated in Figure 3-1. Become familiar with these items prior to operating the Instrument for the first time.

Table 3-1. Operating Items and Features

- 1. Range Switch: Twelve positions: May be rotated 360° in either direction to select any of the five AC & DC voltages, four DC currents & three resistance ranges.
- 2. Function Switch: The function switch has four positions: (Audio), +DC, -DC, and AC . To measure DC current or voltage, set function switch to the -DC or +DC position, depending on polarity of the signal applied across the test leads. To measure AC set the function switch to the AC position. For resistance measurement, switch may be set in either the +DC, -DC or (Audio) position . Polarity of the internal ohm meter battery voltage will be as marked at the jacks when switch is in the +DC position and reversed in the -DC position.
- 3. Zero Ohms: This control is used to compensate for variation in the voltage of the internal batteries when making resistance measurements.
- 4. Circuit Jacks: There are Six jacks on the front panel marked with the functions they represent. These jacks provide the electrical connections to the test leads. The COMMON (-) jack is used (in conjunction with the black test lead) as the reference point for the measurement of all the functions with the exception of the 10A range.
- 5. Point Adjust For Zero: With the Volt-Ohm-Milliammeter in an operating position, check that the pointer indicates zero at the left end of the scale when there is no input. If pointer is off zero, adjust the screw located in the cover below the center of the dial. Use a small screwdriver to turn the screw slowly clockwise or counterclockwise until the pointer is exactly over the zero mark at the left end of the scale. With the indicating pointer set on the zero mark, reverse the direction of rotation of the zero adjuster slightly to introduce mechanical freedom or “play”, but insufficient to disturb the position of the indicating pointer. This procedure will avoid disturbances to the zero setting by subsequent changes in temperature, humidity, vibration, and other environmental conditions.
- 6. Reset Button: This white button is the overload protection circuit breaker. Resetting this button will (XP only) restore meter to full operation, provided overload condition has been removed.

3.3 Polarity Reversing

The function switch provides a convenient means to reverse polarity of the internal battery to facilitate testing semiconductor devices. The +DC and -DC positions transpose internal connections to the COMMON and +jacks and therefore can also be used to reverse polarity of external voltages and currents connected to these jacks (only). Because polarity reversing momentarily interrupts the circuit, it should not be done while measuring current or voltage without first turning off the circuit power. When making measurements on the 250mV, or 10 Amp range, polarity can be corrected only by reversing the test leads.

- b. Set the range switch at one of the five voltage range positions marked 2.5V, 10V, 25V, 60V or 100V. (When in doubt as to actual voltage present, always use the highest voltage range as a protection to the Instrument. If the voltage is within a lower range, the switch may be set for the lower range to obtain a more accurate reading.)
- c. Plug the black test lead into the –COMMON jack and the red test lead into the +jack.
- d. Turn off power to the circuit to be measured and discharge any capacitors.
- e. Connect the test leads across the circuit voltage to be measured with the black lead to the grounded side. (nearest earth ground)
- f. For the 2.5V range, read the value directly on the scale marked 2.5VAC. For the 10V, and 25V ranges, read the red scale marked AC and use the black figure immediately above the scale. For the 100V range, read the red scale and use the black figure immediately above the scale. Multiply reading by 10. For the 600V range, read the value directly on the red scale marked 600V.

3.7.2 AC Voltage Measurement 0-250V Range

Do not attempt any voltage measurement which may exceed 600 volts or the circuit-to-ground voltage of the Instrument, 600 volts maximum.

Be sure that the range switch is set to the 100V/250V/600V range, function switch to AC volts only position, and test leads connected to common and 250V jack.

Do not touch the Instrument or test leads while the power is on the circuit being measured.

Use extreme care when working in high voltage circuits. Do not handle the Instrument or test leads while the circuit being measured is energized. OBSERVE ALL SAFETY PRECAUTIONS in paragraph 3.1 and in the instruction manual for the equipment being tested.



Figure 3.5



- c. Plug the black test lead into the -COMMON jack and the red test lead into the 600V jack.
- d. Make sure power is off in the circuit being measured and all capacitors are discharged. Connect the black test lead to the negative side of the circuit being measured and the red test lead to the positive side of the circuit.
- e. Turn on power in circuit being measured.
- f. Read the voltage using the 0-60 figures on the black scale marked DC. Multiply the reading by 10.

**NOTE:** Turn off power to the circuit and wait until the meter indicates zero before disconnecting the test leads.

### 3.7 AC Voltage Measurement

Branch and distribution circuits (120/240/480V etc.) can deliver dangerous explosive power momentarily into a short circuit before the fuse/breaker opens the circuit. Make certain that the Instrument switches are set properly, jacks are connected properly, and that the circuit power is turned off before making connections to such circuits.

The 260 responds to the average value of an AC waveform. It is calibrated in terms of the RMS value of a pure sine wave. If the waveform is nonsinusoidal, depending on its waveform, the reading may be either higher or lower than the true RMS value of the measured voltage. An error may be introduced if the 260 is used to measure a nonsinusoidal waveform. Also, accuracy is lessened at higher input frequencies (Figure 3-2).

#### 3.7.1 AC Voltage Measurement 0-2.5 Thru 0-100V Range

Before proceeding with the following steps, review the Safety Precautions in Paragraph 3.1.



**Figure 3.4**

- a. Set the function switch to AC position.

**NOTE:** The meter may not indicate if the switch is incorrectly set to a DC position.

### 3.4 Measurement of Unknown Voltage or Current

Sometimes the approximate voltage or current to be measured is known and the correct range may easily be selected. Often, however, particularly when working on faulty equipment, the voltage or current is either unknown or may be much higher than normal and anticipated. When working upon unfamiliar or unknown equipment, always begin a measurement using the highest range available on the Instrument. Once it is determined that the voltage is within the limits of a lower range, change to the lower range.



**Figure 3.1**

### 3.5 Test Leads

These are provided with accessory screw-on alligator clips which may be attached to the probe tips. As well as eliminating the need to hand-hold test prods to a circuit for extended periods, the test clips provide a means of reducing hand proximity to a high voltage circuit while energized. Circuit power must be turned off and any charged capacitors discharged before connecting or disconnecting clips to or from the current.

### 3.6 DC Voltage Measurement

Before making voltage measurements, review the SAFETY PRECAUTIONS listed in paragraph 3.1. Also, when using the 260 as a millivoltmeter, care must be taken to prevent damage to the indicating instrument from excessive voltage.

#### 3.6.1 DC Voltage Measurement 0-250 mV Range

Before using the 250 millivolt range, use the 2.5V DC range to determine that the voltage measured is not greater than 250 mV (or .25 V DC).

- a. Set the function switch at +DC.
- b. Plug the black test lead in the -COMMON jack and the red test lead into the +10 A / 250mV jack.
- c. Set the range switch at 2.5V common position with 250mV.
- d. Connect the black test lead to the negative side of the circuit being measured and the red test lead to the positive side of the circuit.
- e. Read the voltage on the black scale marked DC and use the figures marked 0-25. Multiply by 10 to read in millivolts.

**NOTE:** For polarity reversing see paragraph 3.4.

### 3.6.2 DC Voltage Measurement 0-2.5 Through 0-100V Range

- Set the function switch at +DC.
- Plug the black test lead into the -COMMON jack and the red test lead into the +jack.
- Set the range switch at one of the five voltage range positions marked 2.5V, 10V, 25V, 60V or 100V.

**NOTE:** When in doubt as to the voltage present, always use the highest voltage range as a protection to the Instrument. If the voltage is within a lower range, the switch may be set for the lower range to obtain a more accurate reading. Be sure power is off in the circuit being measured and all capacitors discharged.

- Connect the black test lead to the negative side of the circuit being measured and the red test lead to the positive side of the circuit.
- Turn on the power in the circuit being measured.
- Read the voltage on the black scale marked DC. For the 2.5V range, use the 0-25 figures and multiply by 0.1, for the 10V, 25, and 60V ranges, read the figures directly. For the 100V range, use the 0-10 figures and multiply by 10.

**NOTE:** Turn off power to the circuit and wait until the meter indicates zero before disconnecting the test leads.

### 3.6.3 DC Voltage Measurement 0-250V Range

Use extreme care when working with high voltage circuits. Do not touch the Instrument or test leads while power is on in the circuit being measured.

Before proceeding with the following steps, review the Safety Precautions in Paragraph 3.1.

- Set the function switch at +DC.
- Set the range switch at the 100V/250V/600V position.
- Plug the black test lead into the -COMMON jack and the red test lead into the 250V jack.

- Make sure power is off in the circuit being measured and all capacitors discharged. Connect the black test lead to the negative side of the circuit being measured and the red test lead to the positive side of the circuit.
- Turn on power in circuit being measured.
- Read the voltage on the black scale marked DC. Use the 0-25 figures and multiply by 10.

**NOTE:** Turn off power to the circuit and wait until the meter indicates zero before disconnecting the test leads.



Figure 3.2

### 3.6.4 DC Voltage Measurement 0-600V Range

Use extreme care when working with high voltage circuits. Do not touch the Instrument or test leads while power is on in the circuit being measured.

Before proceeding with the following steps, review the Safety Precautions in Paragraph 3.1.



Figure 3.3

- Set the function switch at +DC.
- Set the range switch at the 100/250V/600V position.